

RISH Max 10 Digital Multimeter







# **RISH Max 10**

### **Overload warning**

An acoustic signal occurs when measuring AC voltage>750V, DC Voltage>1000V, AC/DC mA current>400.0mA, AC/DC current>10.00A.

#### **Energy saving circuit**

The instrument is switched off automatically, if none of the operating elements have been activated for about 15 minutes.

### Protective cover for rough operating conditions

A protective cover of ABS with a built-in stand protects the instrument against jolts and falls. It also secures the test probe for one-hand operation, and allows for winding of the measurement cable which provides protection during transport.

#### Calibration

*Rish* Max -10 multimeters are calibrated using precision calibrators having accuracy better than at least 5 to 10 times depends upon the functions and ranges. These sources are calibrated at regular intervals.

### Theft protection

Company name and name of the user can be entered into the field next to the display with an indelible etching needle for identification of the owner.

- Direct and alternating voltages from  $10 \mu V \ ... \ 1000 V$
- Direct and alternating currents from 10μA ... 10.00A
- Resistances from  $100m\Omega \dots 40.00M\Omega$  with zero correction
- Capacitance from 1pF ... 200.00 $\mu$ F with zero correction .
- Frequencies from 10.00Hz ... 500.0kHz
- Diode measurement and continuity testing
- Hold measurement .
- Relative measurement
- Duty cycle (%) measurement
- Temperature measurement with K type Thermocouple

# Application

*RISH* Max10 digital multimeters are suited for universal, general applications in the electrical and electronics fields, as well as in radio and television service, training and education. They are of especially flat design, and thus fit into any bag. The

protective cover, which is provided as standard equipment, can be opened at an angle for convenient reading from the workbench, and provides for easy transport.

### **Product Features**

### Hold

By pressing the HOLD/ON key, the currently displayed measurement value can be held and "HOLD" is simultaneously displayed.

### **Relative measurement (REL)**

By pressing the REL key, the zero correction is made and Relative Value is measured. All functions can measure Relative Value except Hz/Duty, Diode, Continuity and C functions.

### Automatic/manual measuring range selection

The measurement function are chosen with the rotary selector switch. The measuring range is automatically adjusted to the measurement value. The measuring range can also be manually selected with the AUTO/MAN button.

Note: For Temperature (&), Frequency (Hz), Duty cycle (%) and Capacitance (F) measuring range is AUTO. No Manual range selection is possible.

### **Temperature Measurement**

*Rish Max* - 10 allows you to measure temperature with "K" type Thermocouple (NiCr - Ni) sensor in the range from 0C0 to +1300 C.

### Diode and continuity testing

This provides for the testing of the polarity of diodes, as well as inspection for short -circuits and circuit interruptions. In addition to the display, resistance of less than 100  $\Omega$  (approx.) are indicated with an acoustic signal.

### **Characteristic values for Rish Max - 10**

Meas. Function	Measuring Range	Resolution	Input Impedance	Digital display inherent deviation at reference condition	Overload capacity	
		V(AC)/V(DC)	<u>+(</u> %rdg +digits)	Overload value	Overload Duration	
	400.0mV	100µV	>20MΩ	0.75+2		
	4.000V	1mV	11MΩ		1	
V(DC)	40.00V	10mV	10MΩ	0.5+2	1050V(DC)	Continuous
	400.0V	100mV	10MΩ			
	1000.0V	1V	10MΩ			
V(AC)	400.0mV	100µV	11MΩ	1.5+5		
	4.000V	1mV	11MΩ		1050V(AC) rms	Continuous
	40.00V	10mV	10MΩ	1+5		
	400.0V	100mV	10MΩ	7		
	1000V	1V	10MΩ Approx. voltage drop at max. meas. current	1+10		
	40.00mA	10µA	450mV			
A(DC)	400.0mA	100µA	4.2V	0.8+2	480mA	Continuous
	10.00A 4)	10mA	750mV	1.5+5	4)	4)
A(AC)	40.0mA	10µA	450mV	- 1+5	480mA	Continuous
	400.0mA	100µA	4.2V	1+5		
	10.00A 4)	10mA	750mV	2+5	4)	4)



Analyze

Record

# **RISH Max 10**

Meas. Function	Measuring Range Resolution		Input Digital display inherent deviation at reference condition		Overload capacity	
			V(AC)/V(DC) ±(%rdg +digits)		Overload value	Overload Duration
			Open - circuit voltage			
	400.0Ω	100mΩ		0.8+5		
Ω	4.000ΚΩ	1Ω			500∨	10 min
	40.00ΚΩ	10Ω	approx. 0.45V	0.8+2		
	400.0ΚΩ	100Ω	approx. 0.40V		DC/AC	
	4.000MΩ	1ΚΩ	1	1+5	- rms	
	40.00MΩ	10ΚΩ	1	2+5		
BUZZER	400.0Ω	100mΩ	1	0.8+5 Acoustic signal for 0<100 $\Omega$ approx		
DIODE	1.000V	1mV	approx. 1V	2+10		
F	5.000nF	1pF		3+40 <sup>2)</sup>		
	50.00nF	10pF		2+10 <sup>2)</sup>	1	
	500.0nF	100pF		0.5+3 <sup>2)</sup>	500V DC/AC	10
	5.000µF	1nF		1+2 <sup>2)</sup>	rms	10 min
	50.00µF	10nF		1.5+2 <sup>2)</sup>		
	200.0µF	100nF	fmin	5+10 <sup>3)</sup>		
	10.000Hz	0.001Hz	10Hz			
	100.00Hz	0.01Hz	10Hz	]	<u>≤</u> 1KHz : 1000V	
Hz <sup>5)</sup>	1.0000KHz	0.1Hz	10Hz		<10KHz : 400V	
112	10.000KHz	1Hz	10Hz	0.2+2	Continue	Continuous
	100.00KHz	10Hz	10Hz		<u>≤</u> 500KHz : 40V	
	500.0KHz	100Hz	10Hz	10Hz1KHz: +5D 1KHz10KHz: +5D/KHz	except 400mV	
%	2.098.0%	0.1%	-			
			Sensor		]	
? <b>C</b>	0+1300 °C	1ºC	K NiCr-Ni	2+3	500V DC/AC rms	10 min

At<sup>o</sup>C ... + 40<sup>o</sup>C •

With zero adjustment "REL";

- Time requirement for measurement approximately 60 seconds. •
  - max. 10 A/30 min
    - 12 A/5 min 16 A/30 s
- Indication of the frequency measurement expanded to up to 9999 digit.

2 numbers of 1.5V mignon cell

Zinc- carbon cell as per IEC R6

Alkaline manganese dry cell as

Zinc-carbon cell: approx. 300

Alkaline manganese dry cell:

when battery voltage falls

below following value:

Automatic display of " " symbol

per IEC LR 6

appox. 600 hrs

approx. 2.4 V

hours

### **Reference Conditions**

Ambient temperature	+ 23⁰C + 2 K
Relative humidity	45 % 55 %
Frequency of	
meas. quantity	Sine 50 Hz
Operating voltage	3V + 0.1V

# **Power Supply**

Battery

Service life

Battery test

# **Ambient Conditions**

Operating temperature range Storage temperature range

Relative humidity Elevation

### Display

LCD display field (50 mm x 30 mm) with digital display, and with display of measurement unit, type of current and various special functions.

-10°C ... + 50°C

- 25°C ... + 70°C

up to 2000 m

(without batteries) 45 ... 75 %

### Digital

Display Character height Number of digits Overflow display Polarity display

Measurement rate

### **Fuse**

Fuse for ranges up to 400 mA . Fuse for 10 A range

#### 7 segment 10 mm 3 3/4 digit ≅ 3999 steps OL "-" sign is displayed when plus pole at "⊥' 3 measurement/s for V, I, $\Omega$ , Capacitance, Frequency and Duty cycle measurements

1.6 A / 1000V; 6.3 mm x 32 mm

16 A / 600V; 6.3 mm x 32 mm






Contro

Analyze

# **RISH Max 10**

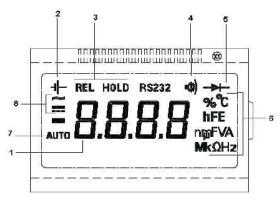

### **RISHmax display**

- 1 Digital display with dot and polarity
- 2 Low Battery Indication
- 3 Display for REL and HOLD
- 4 Continuity test display:
- speaker symbol appears when acoustic signal is switched on
- 5 Display for diode measurement
- 6 Measurement unit display
- 7 Display for automatic measuring range selection
- 8 Display for selected type of Voltage/Current (AC or DC)

### Influence variable and effects

Influence	Influence	Meas. Quantity /	Influence
variable	range	Meas. Range	Effect
Temperature	0 <sup>°</sup> C +21 <sup>°</sup> C and +25 <sup>°</sup> C +50 <sup>°</sup> C	V V ~ mA/A mA/A ~ Ω F Hz Duty (%) C	0.1 x intrinsic error / K

Influence variable	Influence range (max. resolution)	Frequency	Inherrent Error at Ref. <u>±(%rdg.</u> +digits)
Frequency	400mV, 1000V	20Hz <50Hz >50Hz 500Hz	2 + 3
VAC	4V, 40V, 400V	20Hz <50Hz 750Hz 1KHz	2 + 3

Influence variable	Influence range	Meas. Quantity / Meas. Range	Influence Effect
		V ~	
		mA / A ≃	
Relative	55 75%	Ω	1 x Inherent error
humidity		F	enor
		Hz	
		Duty (%)	
		٥C	

Influence variable	Interference Magnitude	Meas. Quantity / Meas. Range	Attenuation
	1000V DC/AC 50Hz sinusoidal	All V DC	>100 dB
Common	1000 VDC	All V DC	>100 dB
Mode		400 mV / 4 V AC	>80 dB
Interference Voltage	1000V AC 50Hz sinus	40 V AC	>63 dB
		400 V AC	>43 dB
		1000 V AC	>23 dB
Series - Mode Interference	MAX. 1000 V AC 50/60Hz	V DC	>43 dB
voltage	MAX. 1000 V DC	V AC	>55 dB

Aux. Voltage Influence

(without  $\neg \vdash$  display)

all ranges except Cap : <u>+</u> 8 D Cap range : <u>+</u> 20 D

#### Applicable regulations and standards

DIN 43751	Digital measuring instruments
DIN EN 60529 DIN VDE 0470 part 1	Test instruments and test procedures -Degree of protection provided by enclosures (IP code)
IS 13875	Digital measuring instruments

# **Mechanical Design**

Protection	Instruments: IP 50 Connector sockets: IP 20
Dimensions	W x H x D: 92 mm x 154 mm x 25 mm
Weight	Approx. 0.25 Kg with battery

## Standard Scope Of Supply

- 1 Cable set
- 1 Multimeter
- 1 Copy Operating Instructions
- 1 Protective Case with tilt stand

Designation	Туре	Order Code
Digital multimeter	RISHmax 10	
RISHmax Probe Set		CONTACT FACTORY
Safety cover RISHmax 10		17.010101

Subject to change without notice





All specifications are subject to change without notice









RISHABH INSTRUMENTS LIMITED Domestic (India): +91 253 2202028/99 | marketing@rishabh.co.in International: +91 253 2202004/06/08/99 | global@rishabh.co.in www.rishabh.co.in